

ALPHA[®] 611 & 620 FLUXES

Mildly Activated Rosin Fluxes-Type RMA (611, 611F, 620, 620-25)

DESCRIPTION

ALPHA 611, 611F, 620 and 620-25 are homogenous solutions of pure water-white gum rosin in organic solvents, to which very effective non-ionic activating agents have been added. All the fluxes meet the classification of ROL0 per J-STD 004 for Type RMA (Rosin Mildly Activated) liquid soldering fluxes.

ALPHA 620 and 620-25 provide superior fluxing strength compared to **ALPHA 611 and 611F**. This can be demonstrated by Meniscograph and solder spread tests.

ALPHA 611 and 611F are formulated for foam application. The high solids content of the fluxes insures effective coverage on dense plated-through-hole circuit boards.

READ ENTIRE TECHNICAL DATA SHEET BEFORE USING THIS PRODUCT

FEATURES AND BENEFITS

- Excellent solder spread allows for proper wetting on parts that can be difficult to solder
- Full bodied flux system with high activity allows for ease of reflow with most common profiles and on varying board types

PRODUCT INFORMATION

<u>Rosin Type:</u> ALPHA 611, 611F, 620 and 620-25 Fluxes contain a quality grade of water-white gum rosin that meets the requirements of Class A of Type 1, Grade WW of Federal Specification LLL-R-626. The high degree of purity of the rosin used insures consistent flux performance.





APPLICATION GUIDELINES

All the fluxes are suitable for use on the following materials, provided the surfaces to be soldered are not excessively tarnished:

Cadmium (plate)	Platinum	Terne (plate)
Copper	Silver	Tin (hot dipped)
Gold	Solder (plate)	Tin (plate)

Palladium

ALPHA 611F requires only low air pressure for a constant, adjustable head of fine bubble foam. Foaming, fluxing, and wetting properties are maintained even during continuous exposure to aeration. Evaporation losses are minimal.


Control: Because of the variety of foam-fluxing equipment available, uniform instructions regarding the use of ALPHA 611F are not feasible. However, optimum results usually can be obtained by following these rules:

- 1. Keep air pressure at the correct level. Too little pressure causes a slow rise; too high a pressure will lower the foam head. Be sure air lines contain traps for moisture and oils that could affect fluxing properties. Replace flux after 40 hours of use.
- 2. To compensate for evaporation losses during operation, adjust specific gravity with the proper thinner at least once a day.
- 3. The flux level covering the stone should be maintained by the addition of fresh flux to compensate for "drag-out" losses. A simple siphon arrangement is adequate.
- 4. Fluxing equipment should be cleaned periodically to remove clippings and debris. The stone should be cleaned in the appropriate Alpha Thinner.

Thinning: It is important to maintain the proper flux solids content for consistent performance. When the specific gravity changes significantly due to evaporation during use, thinner must be added until the proper specific gravity is attained. See graphics below.





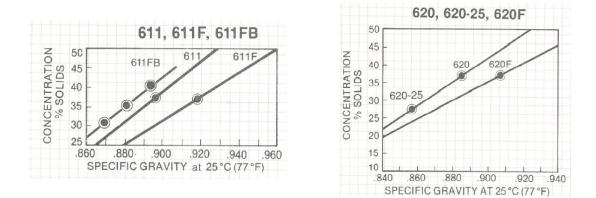

Residue Removal: Flux residues are non-conductive and non-hygroscopic and are, therefore, considered to be non-corrosive in most applications. For effective removal of flux residues on critical electronic assemblies, any solvent cleaner or an aqueous cleaner such as ALPHA 2110 can be used.

Typical Values	ALPHA 611	ALPHA 611F	ALPHA 620	ALPHA 620-25
Specific Gravity @ 25 °C (77 °F)	0.896 +/- 0.005	0.918 +/- 0.005	0.885 +/- 0.005	0.857 +/- 0.005
Pounds per Gallon @ 25 °C (77 °F)	7.45	7.64	7.36	7.14
Flash Point (T.C.C.)	17 °C (62 °F)	18 °C (65 °F)	17 °C (62 °F)	17 °C (62 °F)
Water Extract Resistivity (ohm-cm)	250,000	260,000	182,000	122,000
Recommended Thinner	ALPHA 425	ALPHA 425	ALPHA 425	ALPHA 425
Shelf Life (from Date of Mfg.)	720 days	540 days	540 days	720 days

TECHNICAL DATA

These fluxes are amber liquids, have a solids content of 37% (except for ALPHA 620-25 with a 27% solids content), and are fungus resistant per MIL-E-5272.

AVAILABILITY

Packaging: ALPHA 611, 611F, 620 and 620-25 Fluxes are available in 1, 5, 55 gal containers.





RECYCLING SERVICES

We provide safe and efficient recycling services to help companies meet their environmental and legislative requirements and at the same time, maximize the value of their waste streams.

Our service collects solder dross, solder scrap, and various forms of solder paste waste. Please contact your local sales representative for recycling capabilities in your area or <u>link here</u>.



SAFETY & WARNING

It is recommended that the company/operator read and review the Safety Data Sheets for the appropriate health and safety warnings before use. **Safety Data Sheets are available at MacdermidAlpha.com/assembly-solutions/knowledge-base.**

CONTACT INFORMATION

To confirm this document is the most recent version, please contact Assembly@MacDermidAlpha.com

www.macdermidalpha.com

North America	Europe	Asia
109 Corporate Blvd.	Unit 2, Genesis Business Park	8/F., Paul Y. Centre
South Plainfield, NJ 07080, USA	Albert Drive	51 Hung To Road
1.800.367.5460	Woking, Surrey, GU21 5RW, UK	Kwun Tong, Kowloon, Hong Kong
1.000.307.3400	44.01483.758400	852.3190.3100

Also read carefully warning and safety information on the Safety Data Sheet. This data sheet contains technical information required for safe and economical operation of this product. READ IT THOROUGHLY PRIOR TO PRODUCT USE . Emergency safety directory assistance: US 1 202 464 2554, Europe + 44 1235 239 670, Asia + 65 3158 1074, Brazil 0800 707 7022 and 0800 172 020, Mexico 01800 002 1400 and (55) 5559 1588

DISCLAIMER: All statements, technical information and recommendations contained herein are based on tests we believe to be reliable, but the accuracy or completeness thereof is not guaranteed. No statement or recommendation shall constitute a representation unless set forth in an agreement signed by officers of seller and manufacturer. NO WARRANTY OF MERCHATTABILITY, WARRANTY OF FITNESS FOR A PARTICULAR PURPOSE OR ANY IMPLIED WARRANTY IN FORMARY Shall be to replace any noncompliant products are warranted to be free from defects in material and workmanship at the time sold. The sole obligation of seller and manufacturer under this warranty shall be to replace any noncompliant product at the time sold. Under no circumstances shall manufacturer or seller be liable for any loss, damage or expense, direct, indirect, incidental or consequential, arising out of the inability to use the product. Notwithstanding the foregoing, if products are supplied in response to a customer request that specifies operating parameters beyond those stated above, or if products are used under conditions exceeding said parameters, the customer by acceptance or use thereof assumes all risk of product failure and of all direct, indirect, incidental and consequential damages that may result from use of the products under such conditions, and agrees to exonerate, indemnify, defend and hold harmless MacDermid, Incorporated and its affiliates thereform. No suggestion for product use nor anything contained herein shall be construed as a recommendation to use any product in a manufacturer assume no responsibility or liability for any such infringement.

© 2019 MacDermid, Inc. and its group of companies. All rights reserved. "(R)" and "TM" are registered trademarks or trademarks of MacDermid, Inc. and its group of companies in the United States and/or other countries.

